

XJ range

DATE 05/03

XJ415-01

SERVICE

TECHNICAL BULLETIN

Loss Of Audio/Incorrect Speaker Operation – Water Damage To Amplifier/Audio Components – Apply Sealer MODEL 2004 MY-ON XJ range VIN G00001-ON

Issue:

Customer complaints of loss of audio function or incorrect speaker operation caused by water damage to amplifier/audio components due to water ingress into the left hand side of the luggage compartment.

Action:

If a failure has been identified as mentioned in the summary above, follow the workshop procedure outlined below prior to the installation of new amplifier/audio system components.

Note: Replacement of amplifier/audio system components must be carried out as a separate Warranty Claim.

WORKSHOP PROCEDURE

- 1. Open luggage compartment lid.
- 2. Remove luggage compartment floor carpet.
- 3. Remove luggage compartment left hand side liner.
- 4. Using suitable waterproof cover, protect the amplifier/audio components during the water test.
- 5. With luggage compartment lid open, carefully pour water into the left hand luggage compartment channel. (See Illustration 1)

Note: Ensure bottom left corner of the heated backlight is tested with water.

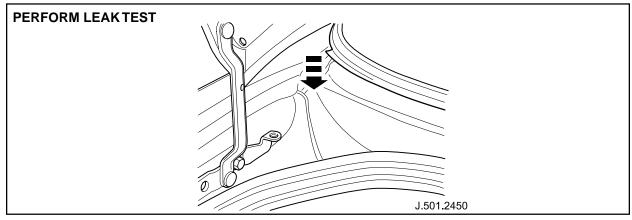


ILLUSTRATION 1



6. Check for water leaks onto the waterproof cover over the amplifier/audio system components.

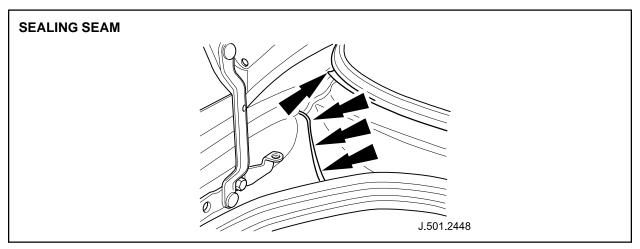


ILLUSTRATION 2

 If water drips onto the water proof cover, use 3M Super Silicone Clear Sealant – 08661 and seal the seam. (See Illustration 2)

Note: Pump sealant into gap at the left hand side bottom corner of the heated backlight to fill the gap.

8. Remove excess sealant from the paint.

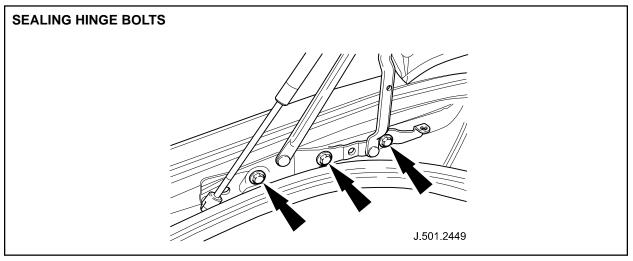


ILLUSTRATION 3

9. Remove one of the bolts securing the left-hand side luggage compartment lid hinge to the body. (See Illustration 3)

Note: Remove the bolts securing the luggage compartment lid hinge to the body one at a time to avoid disturbing hinge alignment.

10. Apply sealant into luggage compartment lid hinge to body securing bolt hole.

- 11. Install and fully tighten left hand side luggage compartment lid hinge to body securing bolt to 18 Nm.
- 12. Carry out steps 9 to 11 for the two remaining left hand side luggage compartment lid hinge to body securing bolts.
- 13. Remove and discard waterproof cover from amplifier/audio system components.
- 14. Install luggage compartment left hand side liner.
- 15. Install luggage compartment floor carpet.
- 16. Close luggage compartment lid.

Parts Information:

3M Super Silicone Sealant - Clear 08661 is considered a workshop consumable and as such may not be claimed.

Warranty Information:

Warranty claims should be submitted quoting the information found in the table below. This will result in payment of the stated time and, where applicable parts/miscellaneous expense codes as listed.

Description	SRO	Time	Causal Part Number
Carry out luggage compartment water test and seal	76.94.22	0.3 hrs.	C2C 7477

