



Sedan Range

DATE 10/95

18-04

SERVICE

TECHNICAL BULLETIN

Security System – Rear Door False Alarm – Repair Information

MODEL 1995 MY Sedan Range
VIN 720001-735432

ISSUE:

Sedan Range vehicles within the above VIN range may experience a security system false alarm that is recorded in the last alarm data as a door intrusion. On some vehicles, the side of the actuator connector facing the rear door lock actuator was incorrectly molded. This may increase the possibility of water entering the connector, which may trigger the vehicle security system intermittently.

ACTION:

In case of a customer complaint of a security system false alarm on a Sedan Range vehicle within the above VIN range, proceed as follows:

1. Inspect the rear door lock actuator on the affected doors for signs of water entry.
2. If corrosion is found, clean the connector and seal the connector with Jaguar electrical contact grease, part no. JLM 11472.
3. If the corrosion is too extensive, the door harness and/or door lock actuator should be replaced as necessary. The replacement parts are the latest design.

PARTS INFORMATION:

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Jaguar electrical grease	JLM 11472	*
Right rear door latch/actuator assembly	GNA 2550BD	1
Left rear door latch/actuator assembly	GNA 2551BD	1
Right rear door harness	LNA 3190CF	1
Left rear door harness	LNA 3190FE	1

*= Claim no more than 25% of container cost per vehicle.



WARRANTY INFORMATION:

FAULT CODE	R.O. NUMBER	DESCRIPTION	TIME ALLOWANCE
RB BD MB	86.25.47	Left rear door lock actuator - replace (with diagnostic time)	1.00 hrs.
RB BD MB	86.25.47.09	Left rear door lock actuator - replace (without diagnostic time)	0.65 hrs.
RB BF MB	86.25.47	Right rear door lock actuator - replace (with diagnostic time)	1.00 hrs.
RB BF MB	86.25.47.09	Right rear door lock actuator - replace (without diagnostic time)	0.65 hrs.
LJ GK PS	86.70.47	Replace left rear door harness (with diagnostic time)	1.15 hrs.
LJ GK PS	86.70.47.09	Replace left rear door harness (without diagnostic time)	0.80 hrs.
LJ HK PS	86.70.47	Replace right rear door harness (with diagnostic time)	1.15 hrs.
LJ HK PS	86.70.47.09	Replace right rear door harness (without diagnostic time)	0.80 hrs.