

Sun Visor Mirror Bulb –  
Now Available Separately –  
Replacement Procedure

MODEL 2002 MY-ON  
X-TYPE  
VIN C00001-ON

**Issue:**

In the event the bulb for the sun visor mirror needs to be replaced, it is no longer necessary to replace the entire sun visor assembly. The bulb is now available separately.

**Action:**

On X-TYPE vehicles, **do not** replace the sun visor assembly if the sun visor mirror bulb is inoperative. Install a new bulb using the procedure outlined below.

WORKSHOP PROCEDURE

1. Reposition sun visor downwards for access.
2. Open the cover of the illuminated mirror.
3. Use a suitable tool to release the retaining tangs of the lens/mirror assembly and remove lens/mirror assembly.
4. Remove defective bulb (Illustration 1).

**SUN VISOR MIRROR BULBS**

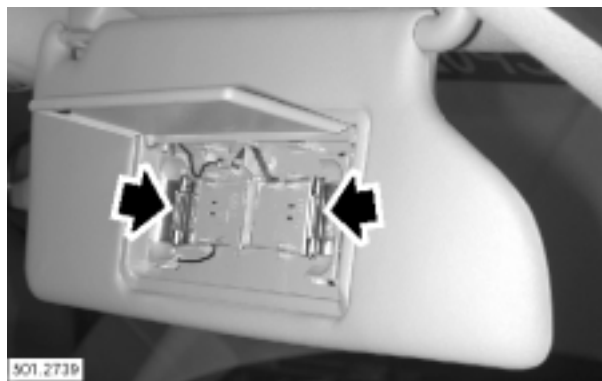


ILLUSTRATION 1

**NOTE: THE INFORMATION IN TECHNICAL BULLETINS IS INTENDED FOR USE BY TRAINED, PROFESSIONAL TECHNICIANS WITH THE KNOWLEDGE, TOOLS, AND EQUIPMENT TO DO THE JOB PROPERLY AND SAFELY. IT INFORMS THESE TECHNICIANS OF CONDITIONS THAT MAY OCCUR ON SOME VEHICLES, OR PROVIDES INFORMATION THAT COULD ASSIST IN PROPER VEHICLE SERVICE. THE PROCEDURES SHOULD NOT BE PERFORMED BY "DO-IT-YOURSELFERS." DO NOT ASSUME THAT A CONDITION DESCRIBED AFFECTS YOUR CAR. CONTACT A JAGUAR RETAILER TO DETERMINE WHETHER THE BULLETIN APPLIES TO YOUR VEHICLE.**

5. Install the new bulb in the sun visor.
6. Install lens/mirror assembly in the sun visor.
7. Close the illuminated sun visor mirror cover.
8. Reposition the sun visor upwards.
9. If required, carry out steps 1 to 8 to the opposite side sun visor.

**Global Technical Reference (GTR) Workshop Manual Information:**

Dealer Access: <https://hub.franchise.jaguar.com>

Internet access: <http://www.jaguartechno.com>

**Parts Information:**

<u>DESCRIPTION</u>	<u>PART NUMBER</u>	<u>QTY</u>
Bulb	LJA 5180BA	1

**Warranty Information:**

Warranty claims should be submitted quoting the information found in the table below. This will result in payment of the stated time and, where applicable parts/miscellaneous expense codes as listed.

Description	SRO	Time	Causal Part Number
Install one, two, three or four new sun visor bulbs	86.45.95	0.2 hrs.	LJA 5180BA

